



Quantum8 V1889 Release Notes

September 2024

New Features and improvements in Quantum8 since V1879.

- Master screen menu bar has been repositioned to the lower part of the screen.
- Meterbridge Status Indicators can now be switched on/off independently from the Master screen status indicators.
- Macroders assignment list can now show more than 4 assignments.
- A new macro command located in the System commands list has been added to disable all touch screen response.
- Bank Switcher's touch can be individually disabled from each screen.
- Solo assign channel also assign screen option has been added for the master sections.
- A keypad has been added for Global tap tempo values.
- When Klang is enabled on a stereo channel, the default width is now 60°.
- Mustard All pass filter phase response is now shown in the Expanded control area EQ.
- The channel macros panel will show where a channel macro is assigned to.
- Switcher card detection has been improved.
- Snapshot panel layout has been adjusted.

Fixes

- Pre Eq/Dyn aux send pick up point corrected.
- Aux rotaries and sends on faders were not showing the same values for KLANG send levels.
- Adding a mono Group in session structure could cause the next stereo group to become mono.
- Worksurface master fader meter would occasionally show signal when no signal was present.
- An Access violation could occur when opening the Snapshot recall scope.
- An Access violation could occur after switching master screen view while changing an FX preset.
- Mix minus didn't work on Channels 257+.
- Odd/Even worksurface Channel TFT displays would occasionally become swapped on power up.
- Converting sessions to Q8 did not always set the correct screen brightness.
- When loading a session or shutting down the console, the confirmation box would occasionally not be displayed and the console would appear to be frozen.
- Using LCD Func > Assign to faders on more than one worksurface would cause the application to Quit.
- Offline software was continuously writing worksurface connection errors to the log.
- Tap tempo values were only reporting in 50ms increments.
- Buss EQ bands 1-4 did not work with Macroders.
- Fader detent did not work on input channels 257+.
- Meterbridge meters would not show the correct meter level if the meter type was changed after start up.
- The application could occasionally freeze and briefly show white screens for a short period before recovering.
- Insert metering was incorrect on stereo channels when any PPM metering was used.
- Bank Switcher Snapshot controls were not Firing macros.
- Switching between Aux pick up points in the expanded control area could cause the console to freeze.